

Installation Instructions for Transformer Advantage_{II} SC, DC, CT & CTX

For additional information on installation & operation, see the Transformer Advantage Owners Manual.

WARNING: Hazardous voltages & currents may be present during installation & operation.



Mounting

1. Unpack the Advantage, including any probes under the cardboard inserts. Check the part number on the unit to determine its configuration (see the Transformer Advantage Configuration Guide). A plastic bag inside the unit contains a fuse, spare screws, resistors & crimp lugs.
2. Select a location at eye level for control access and away from the sun for better display visibility. The surface style Advantage mounts to either the transformer or cabinet using the holes in the mounting flange. When transformer mounting, allow space behind the Advantage for air circulation. To maintain water tightness, do not bend the mounting flange (see illustration of recommended mounting methods in the back of the Owners Manual). Include vibration isolation bushings if the case has noticeable vibration. The panel style mounts to the cabinet wall or door using 1/4" bolts, with the display protruding through the panel.
- 3a. For transformers with thermowells, verify that the diameter and threads match the probes supplied. To match the probe to the well ID, attach the appropriate tip sleeve using the supplied screw (first coat the end of the probe lightly with thermally conductive grease). Insert probe part way into well. Tighten outer probe fitting. Push probe to bottom of the well, then back off 1/16". Tighten compression fitting to probe body.
- 3b. If no thermowell is available, a surface magnetic probe must be used. Select a location away from direct sun, if possible. Apply thermally conductive grease to the center of the magnetic ring. Place the probe in the desired position with the cable pointed down. Seal the perimeter against the tank with silicone caulk.
4. Remove the access cover on the Advantage by removing the two screws at the bottom corners and loosening the two screws under the display. Remove all shipping spacers (marked "DISCARD"). All wiring, except probe wiring, is run through the two large holes on the bottom of the Advantage. These accept 1" conduit fittings. As shipped, one hole is covered by a watertight plug. This can be moved to cover the other hole or removed to use both holes. The optional SO cord fittings accept 0.6-0.7" cable. Unused holes must be sealed against moisture.

Wiring

Connections vary depending on the model and options installed. The wiring diagram for each unit is on the back of the cover plate. Missing screws on a connector indicate that an option is not installed. Begin by wiring to the lowest module first. Leave enough slack in the wires to permit removal of a module without disconnecting wires to other modules.

Analog Retransmit (optional)

5. Connect analog SCADA wiring to the three channel analog retransmit module, if installed (see photo on page three). Shielded twisted pair wire is recommended. For single channel analog output, see step 10.

Auxiliary Inputs & Cooling Feedback (optional on LCAM Module)

6. Connect auxiliary inputs and cooling feedback CTs to the appropriate LCAM channels (if installed). Verify on-board jumpers are set to the proper function and range. If not, unscrew retainer and reposition them.

Relay Wiring

7. Wire alarm & control lines to relays on the cooling control modules (CCA & CCB), as required for your system configuration. All terminals accept #6 ring or spade lugs.

CT Connections (CT & CTX models only)

Connections for a single CT input are on either the CCA relay module or the LCAM module. Connections for multiple CT inputs are always on the LCAM module.



8a. For direct CT wiring: De-energize the transformer or short the CT secondary circuit. Do not open the CT secondary leads with power applied! Identify a tap-in point and connect the secondary leads to the CT input terminals on the Advantage.

8b. The clamp-on CT option does not require breaking the existing CT secondary loop. Locate a sheltered point where one secondary wire is accessible and there is space for the clamp-on CT. The clamp-on is not weatherproof and must be installed in a protective enclosure. Run the clamp-on wires to the CT terminals on the Advantage. Note that this option must be factory configured since it uses a different module than the direct CT input.

Input/Output Module Connections

Note: The terminal block on the I/O module can be removed for easier wiring access. The colored metric screws on this module are not interchangeable with the #6 chrome plated screws on other modules.

9. The single channel analog output option is on terminals I/O-1 and I/O-2. Shielded twisted pair wire is recommended. These terminals are not used if the 3 channel module is installed.

Temperature Probe Connections

10. Feed each probe cable thru one of the small fittings on the bottom of the unit. Tighten the plastic bushing around the metal braid. Connect the probe for top oil to the RTD1 terminals. Small crimp lugs are provided for use on the fine sensor wire. For a four wire probe, connect the red wires to I/O-9 & I/O-10. Connect the white wires to I/O-11 & I/O-15. For a 3 wire probe, connect the two wires of the same color to I/O-9 & I/O-10. Connect the remaining wire to I/O-11. Then jumper I/O-11 to I/O-15, or slide out the I/O module and move J2 over the two pins.


11. CTX, DC, LTC models: Connect the second probe to the RTD2 terminals. For a four wire probe, connect the red wires to I/O-12 & I/O-13. Connect the white wires to I/O-14 & I/O-15. For a 3 wire probe, connect the two wires of the same color to I/O-12 & I/O-13. Connect the remaining wire to I/O-14. Then jumper I/O-14 to I/O-15, or slide out the I/O Module and move J3 over the two pins.

12. On some probes, a fifth wire (connected to the metal braid) is included. This can be tied to the power supply earth terminal or left disconnected (see Owners Manual for more info).

Digital Communications

13a. For 4-wire communications (RS-422 or RS-485), use two twisted pair to connect transmit signals from the controller to the receive terminals on the Advantage, and receive signals from the controller to transmit terminals on the Advantage. Digital common from the controller ties to I/O-20. If needed, add a receive terminating resistor*.

13b. 2-wire RS-485 communication uses a single twisted pair. Wire the twisted pair from the controller to the Advantage (+ to +, - to -). Jumper transmit and receive terminals as shown below. If needed, add a receive terminating resistor*.

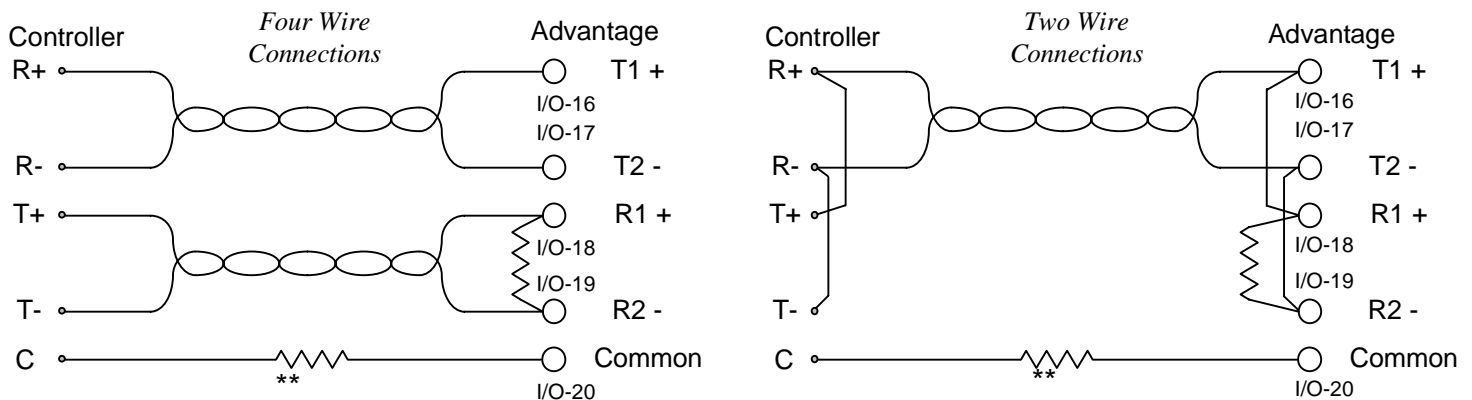

*Terminating resistors only used in device at the end of a multi-drop network. Value depends on controller and bus length.

**The resistor in the common line reduces circulating ground currents. For two wire communication, terminating resistor and common connection are usually not required.

14. A separate RS-232 port is provided for temporary connection to a laptop's serial port. This requires Weschler #1000001701 PC adapter cable. Weschler fiber-optic options also use this port. Temporarily unplug the fiber interface to setup the Advantage from a laptop.

Power

15. Verify that the supply voltage matches the power supply rating of the Advantage. Turn off the power source. Follow the terminal markings on the power supply module to connect external power to the Advantage. An earth ground to terminal 2 is required for EMI & surge protection.

16. Apply power. The Advantage will momentarily display model number and firmware revision level.

Front Panel Setup

The front panel setup menu varies by model. See Owners Manual for specific menu items and explanations.

Note: If the Advantage is displaying USER, skip to step 3.

1. If the Advantage is displaying a temperature or load reading, press and hold the ENT button until CONFIG and OPER are displayed. Press the UP arrow to select SUPER mode. Press ENT.

2. At the PASWD prompt press ENT. Scroll the up & down arrows until the correct password number is displayed (the factory default is 0, contact factory for access if password is unknown). Press ENT to begin setup.


3. Press ENT to begin selection of the first parameter. Push the up & down arrows to change the value. Press ENT to finalize the selection and move to the next parameter.

Follow the flowchart in the manual to enter information via the Advantage front panel supervisor menu. Press the ENT button at the corresponding display prompt to begin the setup sequence for each parameter. Scroll thru the available choices using the up & down buttons. Press ENT to complete the entry process for that item. Many parameters require the selection of several sub-items to completely define the parameter (e.g. setpoint, source and non-alarm coil state for the auxiliary relay). Menu items will only appear for options installed in the unit. If there is no keypad press for 45 seconds while in any setup step, the Advantage will exit the setup mode and return to normal operation.

Configuration software is available to simplify setup, using a laptop computer. This software is included on a CD provided with each unit. The software can also be downloaded from www.weschler.com

Module Position & Terminal Assignment

(Typical configuration for surface mount style)

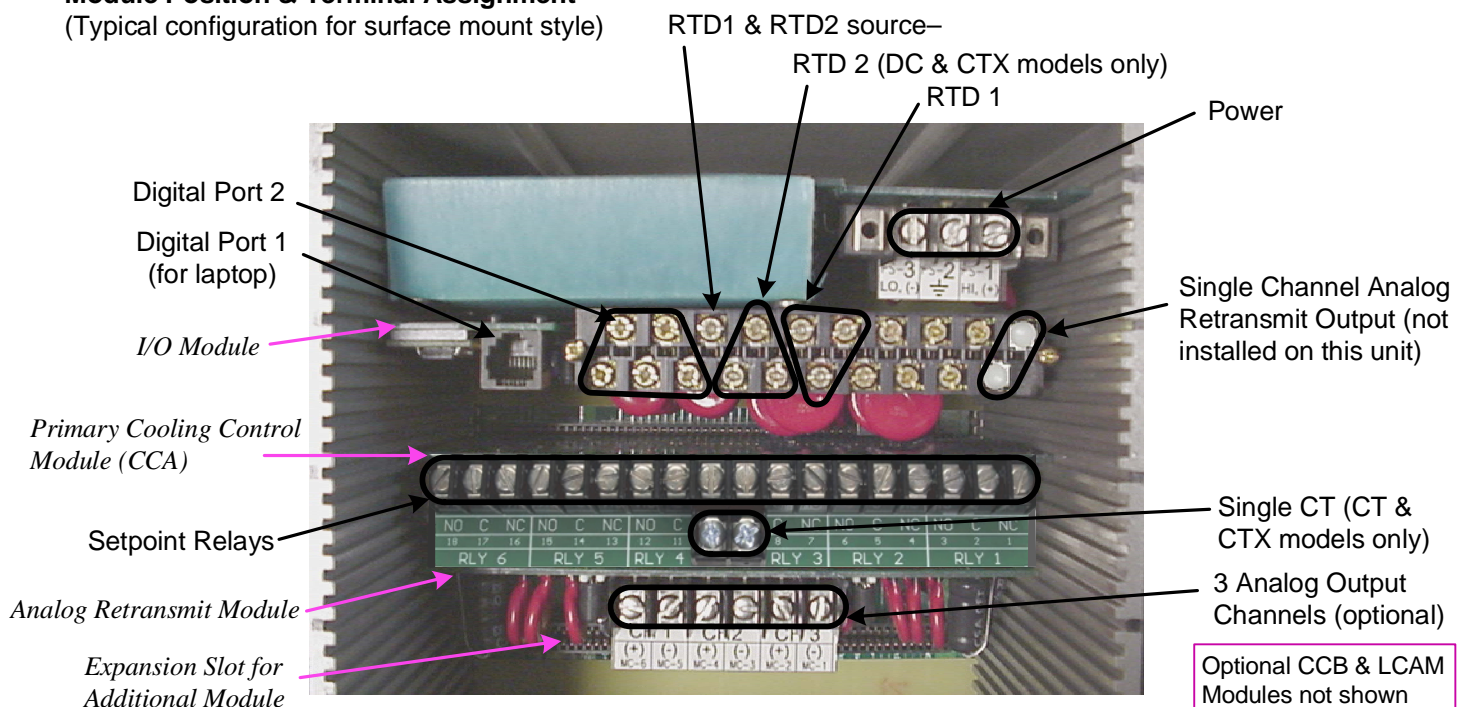

Troubleshooting Common Startup Problems

<u>Symptom</u>	<u>Check</u>
No display	<ul style="list-style-type: none">- correct power supply option ordered- supply voltage & type (AC or DC) at power supply terminals- internal fuse on power supply board- common mode voltage present on DC source- modules in upper compartment loosened in shipping
Only decimal point lights	<ul style="list-style-type: none">- display conserver enabled (see manual)
Flashing Display or Sense Fail display message	<ul style="list-style-type: none">- each probe wire connected to correct terminal- jumper installed for 3 wire probe- terminal block on I/O module firmly seated- correct probe resistance (~110Ω at 25°C)- unused input channels turned off in setup menu
No PC communication at port 1, with Weschler software	<ul style="list-style-type: none">- correct adapter for PC serial port- correct PC com port & Advantage bus ID- correct software for Advantage model and revision level
No digital communication at port 2	<ul style="list-style-type: none">- polarity of transmit & receive lines- Advantage bus ID & port 2 setup- override by connection at port 1- command syntax (see manual)- terminating resistor in or out, as required
Incorrect analog output level	<ul style="list-style-type: none">- zero & full scale current set in uA (e.g. 4000 - 20000 uA)- source selected- zero & full scale temperature set to correct levels
Incorrect alarm	<ul style="list-style-type: none">- wiring to correct terminals- alarm source selected- threshold value entered- non-alarm state entered correctly
Internal Failure display message	<ul style="list-style-type: none">- perform self check calibration step (SLFCK) in SUPER menu- check value displayed at INREF step in OPER menu- cycle power to reset unit
Relay chatter or frequent cycling	<ul style="list-style-type: none">- insufficient hysteresis
Aux Analog Inputs:	
Reading incorrect on one channel	<ul style="list-style-type: none">- check range and function jumpers on module
CT & CTX Models:	
Unable to exit USER setup step	<ul style="list-style-type: none">- required transformer parameter missing- 'connected equipment' parameter not set for all relays
Oil temperature reading incorrect	<ul style="list-style-type: none">- well heater not disabled- offset entered in setup
Load current (CT) reading incorrect	<ul style="list-style-type: none">- CT ratio incorrect- CT on input or output side- clamp-on probe used w/o special clamp-on CCA module- verify proper ICAL calibration setup- verify actual secondary current with clamp-on meter
Winding temperature reading incorrect	<ul style="list-style-type: none">- gradient value incorrect- reading not stabilized (30 minute time constant)
ILoad alarm setpoint too high	<ul style="list-style-type: none">- value above IMAX (scroll down to setting less than IMAX)

WESCHLER INSTRUMENTS

16900 Foltz Parkway Cleveland OH 44149
phone: 440.238.2550 fax: 440.238.0660
web: weschler.com email: sales@weschler.com